



Technical Service BULLETIN

July 7, 2006

Title:

M.I.L. "ON" DTC P0AA6 OR P3009, INFORMATION CODES 526 & 613

Models:

'04 - '07 Prius

ENGINE
EG045-06
REVISED

TSB REVISION NOTICE:

- **May 30, 2007: 2007 model year has been added to Applicable Vehicles. The VINs in the Production Change Information table have been updated. The Applicable Warranty section in Warranty Information has been updated.**
- Previous versions of this TSB should be discarded.

Introduction

Some customers with 2004 to 2007 model year Prius vehicles may experience a M.I.L. "ON" condition with DTC P0AA6 or P3009 with information codes 526 and 613. The transaxle assembly has been improved to prevent this condition.

NOTE:

This TSB applies **ONLY** if **BOTH** information codes 526 AND 613 are present.

Applicable Vehicles

- **2004 - 2006** model year **Prius** vehicles.
- **2007** model year **Prius** vehicles produced **BEFORE** the Production Change Effective VINs shown below.

Production Change Information

MODEL	PLANT		PRODUCTION CHANGE EFFECTIVE VIN*
Prius	Tsutsumi		JTDKB2#U#7 <u>3</u> 249767
	Toyota Auto Body	Line 1	JTDKB2#U#7 <u>7</u> 088464
		Line 2	JTDKB2#U#7 <u>7</u> 634104

* Underlined number in VIN (11th digit) represents assembly plant line code.

Warranty Information

OP CODE	DESCRIPTION	TIME	OFP	T1	T2
EG5033	R & R Hybrid Vehicle Transaxle Assembly	5.9	30900-47040	8A	99
Combo A	Connection of Toyota Diagnostic Tester	0.2			

Applicable Warranty**:

This repair is covered under the Toyota Powertrain Warranty. This warranty is in effect for 96 months or 100,000 miles, whichever occurs first, from the vehicle's in-service date.

For California specification vehicles sold, registered, and operated in California, Connecticut***, Maine, Massachusetts, New Hampshire***, New Jersey***, Rhode Island***, and Vermont, this repair is covered under the California Emission Warranty, which is in effect for 180 months or 150,000 miles, whichever occurs first, from the vehicle's in-service date.

** Warranty application is limited to correction of a problem based upon a customer's specific complaint.



*** Vehicles starting with 2005 model year.



Parts
Information

PREVIOUS PART NUMBER	CURRENT PART NUMBER	PART NAME	QTY
30900-47040	Same	HV Transaxle Assembly	1
00272-SLLC2	Same	Super Long Life Coolant (SLLC)	1
08886-02305	Same	ATF WS	

Required
SSTs

ITEM NO.	SPECIAL SERVICE TOOLS (SSTs)	PART NUMBER	QTY	DRW**
1	Toyota Diagnostic Tester Kit* NOTE: <ul style="list-style-type: none"> All components from this kit/set are required. 12 Megabyte Diagnostic Tester Program Card (P/N 01002593-005) with version 13.3a Software (or later) is required. 	TOY220036	1	9
2	CAN Interface Module Kit* NOTE: <ul style="list-style-type: none"> All components from this kit/set are required. 	01002744	1	9

* Essential SSTs.

** Refers to drawer number in SST Storage System.

NOTE:

Additional Diagnostic Tester Kits, CAN Interface Modules, Program Cards, or other SSTs may be ordered by calling SPX/OTC at 1-800-933-8335.

Repair
Procedure

Remove and replace the hybrid vehicle transaxle assembly.

Refer to the Technical Information System (TIS):

- 2004 or 2005 model year Prius Repair Manual: *Hybrid Transaxle: Hybrid Vehicle Transaxle Assy: Replacement*
- 2006 model year Prius Repair Manual: *Hybrid Transmission / Transaxle: Hybrid Vehicle Transaxle Assembly Removal and Installation*