

Description

Customer states "Red ! on dash along with CEL" after collision repairs have been completed. Use Toyota Techstream scan tool to perform vehicle scan. Found code P0A93 (Inverter Cooling System Performance) as an active failure. Inspect inverter coolant level and found it to be low. Inverter cooling system refill procedure is required to eliminate any air pockets from the cooling system. Perform cooling system refill procedure as outlined in the Toyota service manual to eliminate air pockets as needed. Erase fault memory and perform verification road test. Fault code does not return and CEL (Check Engine Light) is no longer illuminated. Inspect inverter coolant level after road test, good. Customer is advised to let vehicle cool completely and inspect/adjust inverter coolant level as needed.