



TOYOTA

EG-00190T-TME
Version 3
24 November 2020

Technical Service Bulletin

Subject:
Coolant water leak from Front exhaust pipe heat recovery machine

Area of Application:

All Markets

Models – Model Codes:

**Prius - ZVW50, ZVW55 ;
Prius Plug-in Hybrid - ZVW52 ;**

Engine

Revision Content

Introduction

This Technical Service Bulletin is to inform you of the production change and repair method for the subject concern. Applicable to vehicles produced before the production change effective VINs shown below.

Description of the phenomenon

Some customers may experience and report the following symptoms

- Coolant water leak from Front exhaust pipe heat recovery machine
- Overheat due to no coolant water in reservoir tank

Production change

Set up the special Field Fix parts.

The following has been changed:

Improve against thermal stress by adding the reinforcement at heat exchanger

Parts information

Previous part number	New part number	Part name	Quantity
17410-37B52	17410-37D40	PIPE ASSY, EXHAUST, FR	1

Repair procedure

Replace "PIPE ASSY, EXHAUST, FR" according to repair manual.

Warranty information

For the warranty application, please refer to the applicable warranty policy and procedures manual.

Model	Model code	OP code	Operation	Time	OFF	T1	T2
Prius	ZVW50	170171P	Replace "PIPE ASSY, EXHAUST, FR"	1.5	17410-37B52	64	12
	ZVW55	170171P	Replace "PIPE ASSY, EXHAUST, FR"	1.5	17410-37B52	64	12
Prius Plug-in Hybrid	ZVW52	170171P	Replace "PIPE ASSY, EXHAUST, FR"	1.5	17410-37B52	64	12